



2013 Summary Report

for the

Town of Minto

CLIFFORD DRINKING WATER SYSTEM

TABLE OF CONTENTS

1.0	INTRODUCTION.....	1
1.1	Background	1
1.2	Objective	2
1.3	Description of Drinking Water System.....	2
2.0	SUMMARY OF UPGRADES	3
2.1	Upgrades Completed in 2013.....	3
2.2	Upgrades Scheduled to be Completed in 2014	3
3.0	OPERATION OF THE DRINKING WATER SYSTEM	3
3.1	Summary of the Quantities and Flow Rates of Water Supplied.....	3
3.2	Comparison of Actual Rates and Maximum Allowable Rates	7
3.3	Raw Water Qualities and Required Treatment	9
3.4	Summary of Treatment Chemicals Used	10
4.0	COMPLIANCE	11
4.1	Assessment of Compliance	11
4.2	Summary of Compliance	12

LIST OF TABLES

Table 3.1	Clifford Drinking Water System – Well #1.....	4
Table 3.2	Clifford Drinking Water System – Well #3.....	5
Table 3.3	Clifford Drinking Water System – Well #4.....	6
Table 3.4	Clifford Drinking Water System – Well # 3 & 4 Combined.....	7
Table 3.5	Comparison of Flow Rates and Flow Capacities.....	8
Table 3.6	2013 Maximum Water Usage Per Day by Month	8
Table 3.7	2013 Annual Summary of Raw Water Turbidity	1
Table 3.8	2013 Annual Summary of Treatment Chemicals Used.....	11
Table 4.1	Requirements the System Failed to Meet.....	12

**2013 Summary Report
for the
Town of Minto
CLIFFORD DRINKING WATER SYSTEM**

1.0 INTRODUCTION

1.1 Background

In December 2002, the Safe Drinking Water Act (SDWA) was enacted. Subsequently, on June 1, 2003, under the SDWA, a new '*Drinking-Water Systems Regulation*', Ontario Regulation 170/03 (O. Reg. 170/03), was enacted. In addition, several supporting regulations and procedures were also enacted to assist with the administration of O. Reg 170/03. The list of relevant drinking-water legislation is presented in Appendix A.

The SDWA identifies the responsibilities of owners and operating authorities of municipal drinking water systems (SDWA, Sections 11 and 19). Their duties include ensuring that:

- All water provided by the drinking-water system meets prescribed drinking-water quality standards;
- The drinking-water system is operated in accordance with the Act and regulations and is kept in a good state of repair;
- All facilities are appropriately staffed and supervised;
- All sampling, testing and monitoring requirements are complied with;
- All reporting requirements are complied with; and
- Only persons holding valid operator's certificates operate the drinking-water-system.

O. Reg. 170/03 establishes the standard for protection of drinking water. It includes sets of schedules, specific to municipal residential systems that define requirements for:

- Minimum treatment levels;
- Operational checks;
- Chemical and microbiological sampling and testing;
- Adverse results reporting;
- Corrective procedures; and
- Report documentation and retention.

The system's Municipal Drinking Water Licence (MDWL) and Drinking Water Works Permit (DWWP) imposes system specific rules and conditions applicable to the standards set out in O. Reg. 170/03.

1.2 Objective

This Summary Report for the Clifford Drinking Water System is being prepared in fulfillment of Schedule 22 of O. Reg. 170/03, and will be given to Members of the Municipal Council. It covers the period from January 1, 2013 to December 31, 2013.

This Summary Report lists any requirements of the Act, the regulations, the C. of A., the MDWL, the DWWP and any order that the system failed to meet during the period of this report. For any such failure, the measures that were taken to correct the failure are detailed. The report also includes relevant information that will assist the Town of Minto to assess the water work's capability to meet existing and future planned uses of the system.

1.3 Description of Drinking Water System

Clifford is a community with a population of approximately 804 persons, located within the Town of Minto at the northwest corner of Wellington County, along the route of Provincial Hwy. No. 9.

Clifford is serviced by a municipal Drinking Water System that is comprised of: three drilled well supplies, two pumphouses, an elevated 1,275 m³ storage tank and a distribution network of watermains. The watermains range in diameter from 100 mm to 250 mm. The municipal water system is also used for fire protection and has approximately 46 fire hydrants throughout the distribution system. In the event of a prolonged power outage, a portable generator is available in pumphouse #1, #3 & # 4 to supply back-up power.

Well #3 is a deep overburden well, and serves as the primary production well for the system. Wells #1 and #4 are bedrock wells and provide peak flows and redundancy to the system. Wells #3 and #4 are a *combined supply*, and are not allowed to operate together. All three operating wells are equipped with submersible pumps; the pump in Well #3 is a variable speed pump.

The pumphouse on Allan Street serves Well #1. The second pumphouse is in the base of the elevated storage tank on Nelson Street and serves Wells #3 and #4. The treatment employed in both pumphouses includes the use of sodium silicate for the sequestering of iron and sodium hypochlorite for disinfection of the raw water. A continuous online analyser measures the levels of free chlorine residual at point of entry (POE). When the alarm for chlorination system failure is activated, there is a corresponding lockout of well pumps. Subsequent to treatment, supply from Well #1 is discharged from the chlorine contact pipe into the distribution system, while supply from Wells #3 and #4 is discharged from the chlorine contact pipe directly into the elevated storage tank from the Cl₂ contact pipe.

The Clifford Drinking Water System operates under MDWL 106-101, DWWP 106-201, PTTW (Well #1) #6117-62MQDH From January 1 to September 24, #7507-9BPRTS September 25 to December 12, #1810-9ECR5M starting December 13 and PTTW (Wells #3 and #4) #5364-7ZWRQJ.

2.0 SUMMARY OF UPGRADES

2.1 Upgrades Completed in 2013

The disinfection treatment system in the Clifford Drinking Water System meets all of the standards imposed by O. Reg. 170/03 and the MOE's "*Procedures for Disinfection of Drinking Water in Ontario*".

Typically, maintaining the system includes repairs and/or replacement of individual components as necessary. \$6,723.00 was spent on a flow control valve replacement, \$8,599.00 on water tower upgrades and approximately \$111,522.00 was spent installing and replacing watermain.

The following purchases were also made on equipment that is shared between all of Minto's water systems. \$3,015.00 on computer equipment, \$6,353.00 on PLC upgrades for the SCADA system, \$386,129.00 on the water meter installation program and \$23,863.00 to replace a truck.

Preventative maintenance measures are being followed to ensure proper operation of the Drinking Water System.

2.2 Upgrades Scheduled to be Completed in 2014

In 2014, the Town of Minto is planning to spend \$3,000.00 on Well # 1, replace watermain on Ann St. at an estimated cost of \$65,000.00, replace watermain on Clark St. at James and Queen at an estimated cost on \$130,000.00 as well as valve replacements at an estimated cost of \$1,500.00.

In 2014 the following will be purchased to be shared within the water department.

One vehicle replacement for approximately \$20,000.00, upgrades to the SCADA system at an estimated cost of \$30,000.00, \$650,000.00 on the water meter installation program, \$15,000.00 on a rate study, \$35,000.00 on generator replacements and \$3,500.00 on hydrants.

3.0 OPERATION OF THE DRINKING WATER SYSTEM

3.1 Summary of the Quantities and Flow Rates of Water Supplied

O. Reg. 170/03 stipulates that a summary of the quantities and flow rates of the water supplied from each of Clifford's wells be included in the Summary Report. Tables 3.1, 3.2 and 3.3 provide a summary of quantities and flow rates supplied during 2013, for Wells #1, #3 and #4 respectively, on a monthly basis. Well #1 supplies the Allan Street Wellhouse. Wells #3 and #4 supply the Nelson Street Wellhouse; they are a *combined* supply and are not allowed to operate together.

Table 3.1
Clifford Drinking Water System - Well #1
Treated Water Flow, Turbidity, and Disinfectant Residual
January 1, 2013 - December 31, 2013

Month	Raw Water Flow (Max Daily Volume = 1309 m ³ /day) (Max Flow Rate = 15.15 L/s)			Chlorine Monthly Total (L)	Monthly Averages			Distribution System Disinfectant	
	Instantaneous Peak flows (L/s)	Maximum Day Flow (m ³ /day)	Monthly Total (m ³)		Treated Water Turbidity	Treated Water Disinfectant	No. of Samples Collected	Average Residual (mg/L)	No. of Dis- Samples Collected
January	13.5	877	4,548	100	5	0.22	31	1.13	See Clifford Well #3 Data
February	13.5	205	3,520	90	4	0.38	28	1.20	
March	13.5	180	4,308	111	6	0.16	32	1.10	
April	13.6	236	3,870	63	6	0.36	29	1.27	
May	13.5	220	3,575	126	5	0.49	31	1.07	
June	13.5	188	3,522	94	10	0.48	30	1.02	
July	13.4	230	3,620	66	7	0.19	31	0.97	
August	13.4	207	3,140	109	11	0.54	33	1.10	
September	13.4	252	3,737	84	6	0.36	30	1.18	
October	13.4	177	3,428	126	5	0.62	31	1.31	
November	13.4	179	4,003	130	4	0.43	30	1.36	
December	13.4	214	4,493	128	4	0.43	30	1.32	
Total			45,764	1,227	73		366		
Average			3,814			0.39		1.17	
Maximum	13.6	877							

Disinfectant Compound Used: **12% Sodium Hypochlorite**
 Form of Residual Displayed: **Free**
 Quantity of Disinfectant Used During 2013: **1,227 L**
 Distribution System Target Residual: **0.2 mg/L**

Table 3.2
Clifford Drinking Water System – Well #3
Treated Water Flow, Turbidity, and Disinfectant Residual
January 1, 2013 – December 31, 2013

Month	Raw Water Flow (Max Flow Rate = 15.2 L/s) (Max Daily Volume = 1309 m ³ /d) This is the allowable combined limits for Well # 3 & Well # 4			Chlorine Monthly Total (L)	Monthly Averages				Distribution System Disinfectant	
	Instantaneous Peak Flow (L/s)	Maximum Day Flow (m ³ /day)	Monthly Total (m ³)		Treated Water Turbidity		Treated Water Disinfectant		No. of Samples Collected	No. of Samples with Detectable Residual
					No. of Samples Collected	Daily Average Turbidity	No. of Treated Samples Collected	Average Residual (mg/L)		
January	4.5	143	2,624	40	6	0.32	29	1.19	48	48
February	4.5	336	2,520	30	6	0.37	26	1.22	43	43
March	4.5	225	2,538	60	6	0.27	31	1.38	48	48
April	4.5	326	2,852	60	6	0.34	30	1.3	48	48
May	4.5	259	3,696	56	4	0.40	30	1.2	50	50
June	4.5	192	2,894	66	10	0.50	29	1.14	45	45
July	4.5	210	3,672	87	8	0.23	31	1.19	52	52
August	4.5	223	3,517	88	11	0.44	31	1.25	53	53
September	4.5	177	2,741	56	8	0.50	30	1.23	48	48
October	4.5	244	3,420	86	6	0.42	31	1.26	48	48
November	4.8	136	1,060	84	2	0.21	14	1.38	48	48
December	4.5	162	3,236	88	4	0.16	31	1.24	47	47
Total			34,770	801	77		343		578	578
Average			2,898			0.35		1.25		
Maximum	4.8	336								

Disinfectant Compound Used: 12% Sodium Hypochlorite
Form of Residual Displayed: Free
Quantity of Disinfectant Used During 2013 for Wells #3 and #4 combined: 801 L *(Wells #3 and #4 share the same Cl₂ storage container)
Distribution System Target Residual: 0.2 mg/L

Table 3.3
Clifford Drinking Water System – Well #4
Treated Water Flow, Turbidity, and Disinfectant Residual
January 1, 2013 – December 31, 2013

Month	Raw Water Flow (Max Flow Rate = 15.2 L/s) (Max Daily Volume = 1309 m ³ /d) This is the allowable combined limits for Well # 3 & Well # 4			Chlorine	Monthly Averages				Distribution System Disinfectant	
	Instantaneous Peak flow (L/s)	Maximum Day Flow (m ³ /day)	Monthly Total (m ³)		Treated Water Turbidity		Treated Water Disinfectant		No. of Samples Collected	No. of Samples with Detectable Residual
					No. of Samples Collected	Daily Average Turbidity	No. of Treated Samples Collected	Average Residual (mg/L)		
January	10.4	36	843	See Clifford Well #3 Data	2	0.84	16	1.01	See Clifford Well #3 Data	
February	10.3	78	1,323		5	0.47	28	1.19		
March	10.1	54	967		5	0.39	32	1.18		
April	9.9	130	1,055		6	0.49	28	1.24		
May	10.0	59.0	937		5	0.54	31	1.12		
June	10.0	51	976		9	0.54	28	1.17		
July	9.9	65	941		7	0.43	31	1.07		
August	9.9	67	961		9	0.47	30	1.25		
September	10.0	193	1,166		8	0.54	30	1.29		
October	9.9	50	988		5	0.63	30	1.19		
November	10.1	125	2,000		4	0.50	29	1.15		
December	10.1	125	1,235		4	0.21	29	1.23		
Total			13,392	69	0.50	342				
Average			1,116				1.17			
Maximum	10.4	193								

Disinfectant Compound Used: **12% Sodium Hypochlorite**
 Form of Residual Displayed: **Free**
 Quantity of Disinfectant Used During 2013 for Wells #3 and #4 combined: **801 L** *(Wells #3 and #4 share the same Cl₂ storage container)
 Distribution System Target Residual: **0.2 mg/L**

Table 3.4
Clifford Drinking Water System – Well #3 & #4 Combined
Treated Water Flow
January 1, 2013 – December 31, 2013

Month	Treated Water Flow (Max Daily Volume = 1309 m ³ /d) (Max Flow Rate = 15.2 L/s)			Chlorine
	Instantaneous Peak flow (L/s)	Maximum Day Flow (m ³ /day)	Monthly Total (m ³)	Monthly Total (l)
January	14.9	143	3,467	40
February	14.8	336	3,843	30
March	14.6	225	3,505	60
April	14.4	326	3,907	60
May	14.5	259	4,633	56
June	14.5	192	3,870	66
July	14.4	210	4,613	87
August	14.4	223	4,478	88
September	14.5	193	3,907	56
October	14.4	244	4,408	86
November	14.9	136	3,060	84
December	14.6	162	4,471	88
Total			48,162	771
Average			4,014	
Maximum	14.9	336		

3.2 Comparison of Actual Rates and Maximum Allowable Rates


O. Reg. 170/03 stipulates that a summary of the quantities and flow rates of the water supplied from each of Clifford’s wells be included in the Summary Report and compared against the rated capacity and flow rate for the system. As such, a comparison of the instantaneous peak flow to the PTTW’s rated capacity is included and a comparison of the maximum daily flow to the MDWL’s rated capacity is included in Table 3.5..

Table 3.5
Comparison of Flow Rates and Flow Capacities
To
Rated Flow Rate (PTTW) and Rated Capacity (MDWL)

Well Supply	PTTW Max. Flow Rate	Maximum Instantaneous Peak Flow	Percent of Maximum Allowable	MDWL Schedule Maximum Daily Quantity	PTTW Maximum Daily Flow	Percent of Maximum Allowable
	L/s	L/s	%	m ³ /day	m ³ /day	%
Well #1	15.1	13.6	90	1,310	877	67
Well #3	7.6	4.8	63	655	336	51
Well #4	15.1	10.4	69	1,309	193	15

The MDWL stipulates, “The maximum daily volume of treated water that flows from the treatment subsystem to the distribution system shall not exceed the value identified as the rated capacity in Schedule C Table 1.”

Table 3.6
Maximum Water Usage Per Day by Month

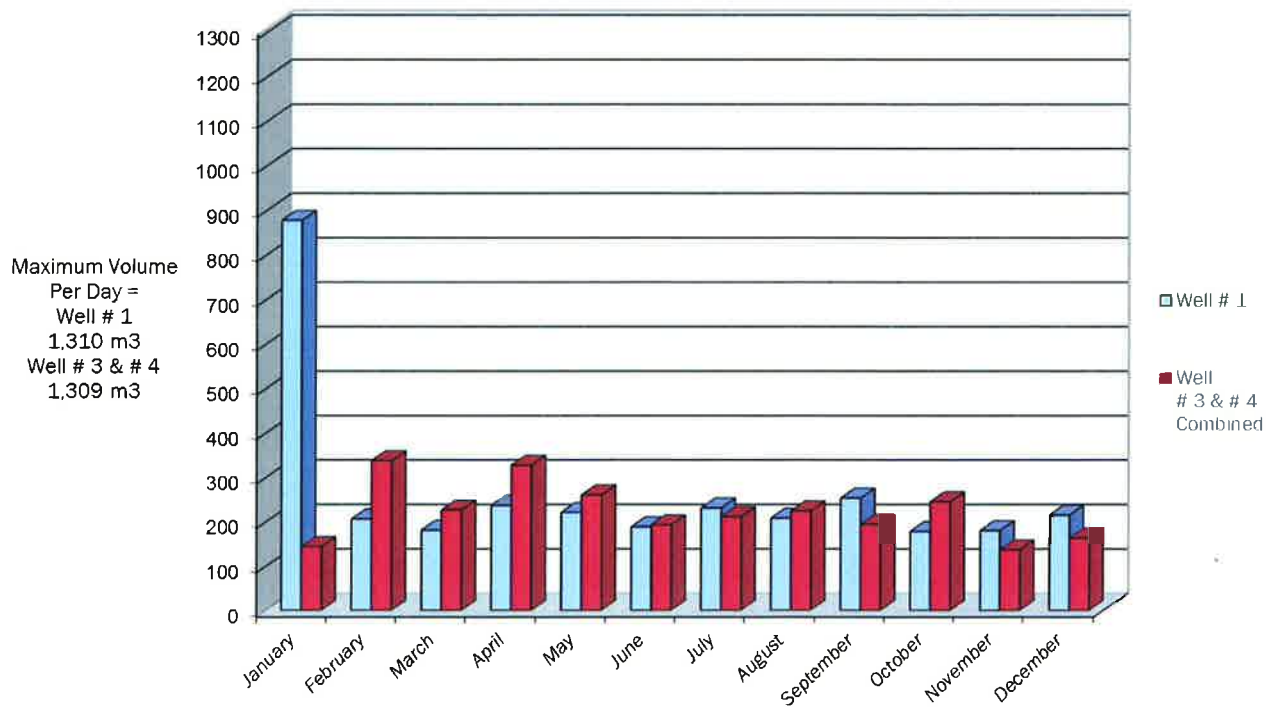

January - Well # 1 was the duty well due to Well # 3 and Well # 4 being offline.

Short-term peaks, in excess of permitted values, may occur at pump start up, while doing specific maintenance procedures or during emergency demand situations. An occurrence of this nature is not considered an exceedance.

The time and duration of any flow exceedance is recorded for each event along with the reason for the occurrence. There were no exceedances of the allowable flow rates in the Clifford Drinking Water System.

3.3 Raw Water Qualities and Required Treatment

The Clifford Drinking Water System has no naturally occurring chemical parameters that exceed MAC or IMAC limits.

The Allan Street Wellhouse (*Well #1*) and the Nelson Street Wellhouse (*Wells #3 and #4*) are equipped with continuous monitoring analyzers for measuring free chlorine residuals. The chlorine analyzer is equipped with an alarm to a monitoring centre who will call the on-call water operator to notify of a critical alarm. The average monthly turbidity and free chlorine residual measurements for treated water are presented in Tables 3.1, 3.2 and 3.3.

There were no high turbidity readings (>1.0 NTU) experienced in 2013. The minimum, maximum, and average turbidity readings for raw water from each well are presented in Table 3.7.

Sodium Hypochlorite is the disinfectant used for Wells #1, #3 and #4. Free chlorine residual is monitored continuously at the "Point of Entry" (POE) into the distribution system. Additional "grab samples" are taken daily (*excluding weekends and holidays*) within the distribution system and tested for the free chlorine residual. The minimum, maximum and average values of free chlorine residual at the POE are presented Table 3.7. Also included in Table 3.7 is the range of free chlorine residual within the distribution system.

The free chlorine residual in the distribution system ranged between 0.44 mg/L and 1.66 mg/L. O. Reg. 170/03, Schedule 1-2 stipulates that the free chlorine residual can never be less than 0.05 mg/L. In addition, O. Reg. 170-03, Schedule 1-4 stipulates that the water treatment equipment must be " ...capable of achieving, at all locations within the distribution system, a free chlorine residual of 0.2 mg/L ...". The Clifford Drinking Water System meets both of these requirements.

**Table 3.7
 2013 Annual Summary of
 Raw Water Turbidity and Free Chlorine Residual
 for Clifford Drinking Water System**

Location	Range	Raw Water Turbidity	Free Chlorine Residual at POE
		NTU	mg/L
Well #1	Minimum	0.10	0.61
	Maximum	0.80	1.56
	Average	0.33	1.17
Well #3	Minimum	0.08	0.81
	Maximum	0.68	1.78
	Average	0.28	1.25
Well #4	Minimum	0.07	0.82
	Maximum	0.81	1.60
	Average	0.42	1.19

3.4 Summary of Treatment Chemicals Used

The disinfectant chemical used in the Clifford Drinking Water System is 12% sodium hypochlorite (CL₂). Measurements of free residual are recorded on a continuous basis. Wells #3 and #4 share the same CL₂ storage container; 801 L of CL₂ is the combined usage for Wells #3 and #4. In 2013, a total of 2,028 L of CL₂ was used for all three wells. The annual average dosage rates for Well #1, and Wells #3 and #4 are presented in Table 3.8.

In 2013, 994 L of sodium silicate was used for the sequestering of iron. The annual average dosage rates for Well #1, Well #3 and Well #4 are presented in Table 3.8.

**Table 3.8
 Clifford Drinking Water System
 2013 Annual Summary of
 Treatment Chemicals Used**

Treatment Chemical	Well	Volume Used	Mass Used	Annual Flow	Dosage Rate
		L	kg	m ³	mg/L
12 % Cl ₂	Well #1	1,227	147.2	45,764	3.22
	Well #3 & Well #4	801	96.1	48,162	2.00
	Total	2,028	243.4	93,926	2.59
Sodium Silicate	Well #1	390	542.1	45,764	11.85
	Well # 3 & Well #4	604	839.6	48,162	17.43
	Total	994	1,382	93,926	15

- Note:
- Wells #3 and #4 share the same Cl₂ storage container; 801 L is the combined Cl₂ usage for both wells.
 - Wells #3 and #4 share the same storage container for the sequestering agent, sodium silicate (NaSi); 604 L is the combined NaSi usage for both wells
 - 12% Sodium Hypochlorite = 120,000 mg/L = 120 kg/m³
 - Sodium Silicate has a specific gravity = 1.39

4.0 COMPLIANCE

4.1 Assessment of Compliance

The objective of the Summary Report is to list any requirements of the Act, the regulations, the MDWL, the DWWP and any MOE order that the system failed to meet from January 1, 2013 to December 31, 2013, and the corresponding corrective measure(s) taken. Compliance was assessed as follows:

- There were **no MOE Orders** issued to the Clifford Drinking Water System in 2013.
- The MDWL imposes the specific rules and conditions governing the standards set out in O. Reg. 170/03. It is an important instrument in defining the requirements of compliance of a Drinking Water System.
- O. Reg. 170/03 establishes the standard for protection of drinking water; specifically, through 12 schedules that municipal residential drinking systems must follow to meet the requirements of the regulation.
- The SDWA clearly identifies the responsibilities of owners and operating authorities of municipal drinking water systems. It places a recommended statutory standard of care on those who have oversight of municipal drinking-water systems. In essence, the standard of care has two themes: be informed and exercise diligent oversight.

4.2 Summary of Compliance

To the best of our knowledge and ability we are in, or diligently working towards, compliance, with all of the requirements of the SDWA, O. Reg. 170/03, as well as the Clifford Water Work's MDLW 106-101, DWWP 106-201, PTTW (Well #1) #6117-62MQDH From January 1 to September 24, #7507-9BPRTS September 25 to December 12, #1810-9ECR5M starting December 13 and PTTW (Wells #3 and #4) #5364-7ZWRQJ.. Every attempt has been made to ensure this document is an accurate representation of how the Drinking Water System is operated

To the best of our knowledge, Table 4.1 identifies all of the requirements of the SDWA, the regulations, the MDWL, the DWWP. and the PTTW.

**Table 4.1
 Clifford Drinking Water System
 Requirements the System Failed to Meet**

Compliance With	Description of Item the System Failed to Meet	Correction of This Situation How/When
MDWL # 106-101	<i>Clifford Drinking Water System is in compliance with all of the requirements of the MDWL</i>	
DWWP # 106-201	<i>Clifford Drinking Water System is in compliance with all of the requirements of the DWWP</i>	
O. Reg. 170/03	<i>Clifford Drinking Water System is in compliance with all of the requirements of O. Reg. 170/03</i>	
SDWA	<i>Clifford Drinking Water System is in compliance with all of the requirements of the SDWA.</i>	

Dated this 7th day of March 2014.


 Brian Hansen
 Public Works Director